




Classified by
Underwriters Laboratories, Inc.
to UL 1479 and CAN/ULC-S115

System No. F-C-7059

FC 7059


ANSI/UL1479 (ASTM E814)	CAN/ULC S115
F Rating — 1 Hr	F Rating — 1 Hr
T Rating — 1 Hr	FT Rating — 1 Hr
	FH Rating — 1 Hr
	FTH Rating — 1 Hr

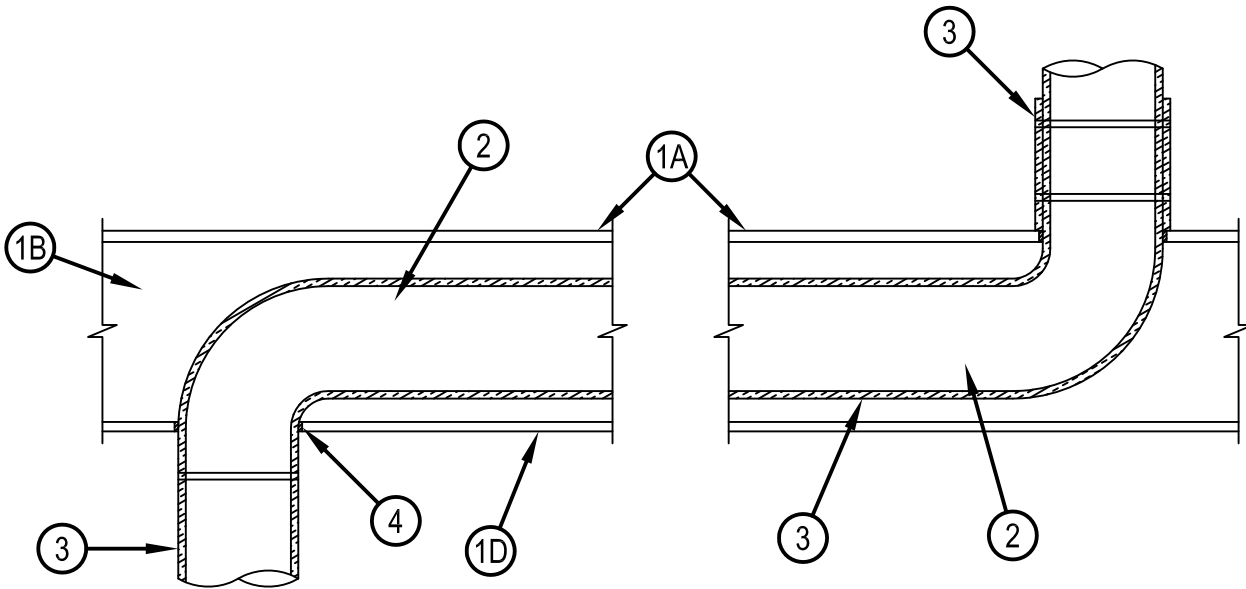

1. Floor-Ceiling Assembly — The 1 hr fire-rated solid or trussed lumber joist floor-ceiling assembly shall be constructed of the materials and in the manner specified in the individual L500 Series Floor-Ceiling Designs in the UL Fire Resistance Directory. The general construction details of the floor-ceiling assembly are summarized below:

- A. Flooring System — Lumber or plywood subfloor with finish floor of lumber, plywood or Floor Topping Mixture* as specified in the individual Floor-Ceiling Design. Max diam of floor opening is 8-1/2 in. (216 mm).
- B. Wood Joists — Nom 10 in. (254 mm) deep (or deeper) lumber, steel or combination lumber and steel joists, trusses or Structural Wood Members* with bridging as required and with ends firestopped. Additional framing members installed to form a square enclosure around the perimeter of the opening in the floor and ceiling.
- C. Furring Channels — (Where Required - Not Shown) - Resilient galv steel furring installed perpendicular to wood joists between gypsum board and wood joists as specified in the individual Floor-Ceiling Design. Furring channels spaced max 24 in. (610 mm) OC. If furring channels are used within the assembly, additional furring channels to be installed along the periphery of the opening.
- D. Gypsum Board* — Nom 4 ft (1.2 m) wide by 5/8 in. (16 mm) thick as specified in the individual Floor-Ceiling Design. Gypsum board secured to wood joists or furring channels as specified in the individual Floor-Ceiling Design. Max diam of ceiling opening is 8-1/2 in. (216 mm).

2. Steel Air Duct — Max 7 in. (178 mm) diam by min 0.0157 in. (No. 30 gauge or 0.40 mm) thick galv steel air duct to be centered within the opening. Max one steel air duct to be installed within opening. Steel duct to be rigidly supported on top side of floor-ceiling assembly.

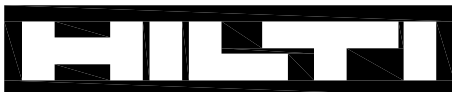

Hilti Firestop Systems

Reproduced by HILTI, Inc. Courtesy of
Underwriters Laboratories, Inc.

January 21, 2015

System No. F-C-7059

FC 7059

3. Duct Wrap Materials* — Nom 1/2 in. (13 mm) thick, 8 pcf (128 kg/m³) with or without foil-scrim facers. The steel duct shall be wrapped with one layer of duct wrap installed with 1 in. (25 mm) transverse and longitudinal overlaps or tightly butted compression joints in accordance with the manufacturer's installation instructions. The duct wrap is secured with min No. 16 Gauge (0.050 in. or 1.3 mm) galvanized steel wire formed into a loop on one end, with the other end passed through the loop, pulled hand tight and bent over. Tie wires spaced a max 12 in. (305 mm) OC. The annular space between the insulated steel duct and the periphery of the opening shall be a nom 1/4 in. (6 mm). A min 12 in. high collar consisting of an additional layer of 1/2 in. (12.7 mm) thick, 8 pcf (128 kg/m³) duct wrap, installed over the duct wrap flush with the top surface of the floor and extending upward.

THERMAL CERAMICS INC — FireMaster DryerWrap, FireMaster FastWrap XL, Pyroscat Duct Wrap XL.

4. Fill, Void or Cavity Material* - Sealant — Min 5/8 in. (16 mm) thickness of fill material applied within annulus, flush with the bottom surface of ceiling. Min 3/4 in. (19 mm) thickness of fill material applied within annulus on top surface of floor.

EGS NELSON FIRESTOP — ES1399 or LBS3 Sealant.

HILTI CONSTRUCTION CHEMICALS, DIV OF HILTI INC — FS-ONE Sealant or FS-ONE MAX Intumescent Sealant


RECTORSEAL — 835+ Sealant.

SPECIFIED TECHNOLOGIES INC — SpecSeal Series SSS Sealant, SpecSeal LC150 Sealant, SpecSeal LE600 Sealant or SpecSeal LCI Sealant.

THERMAL CERAMICS INC — FireMaster Putty.

TREMCO INC — TREMstop Intumescent Acrylic Sealant, or TREMstop IA+.

* Indicates such products shall bear the UL or cUL Certification Mark for jurisdictions employing the UL or cUL Certification (such as Canada), respectively.

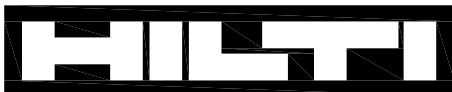

Hilti Firestop Systems

Reproduced by HILTI, Inc. Courtesy of
Underwriters Laboratories, Inc.
January 21, 2015

Page: 2 of 2